6. Remove diagonally opposite bolts from hood side center hinges, "B", Figure 1.
7. Install two bonding straps (one each side of vehicle) part #B184726 as illustrated in Figure 1, at "B", and in Figure 4 using 4 star washers part #178551 between the bond straps and the hinge.

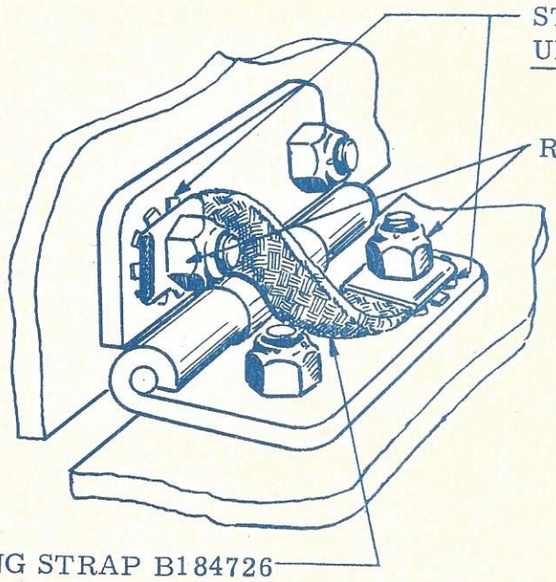


FIGURE 4

8. Install contact bond at hood anti-rattler plate as illustrated at "C" in Figure 1 using two contact bond part #B184730 and two star washers part #178551 (one each on each side of car). For detailed sketch see Figure 5.
9. Scrape paint off and "tin" hood to assure proper contact with contact bond at anti-rattler plate. See "D", Figure 1.

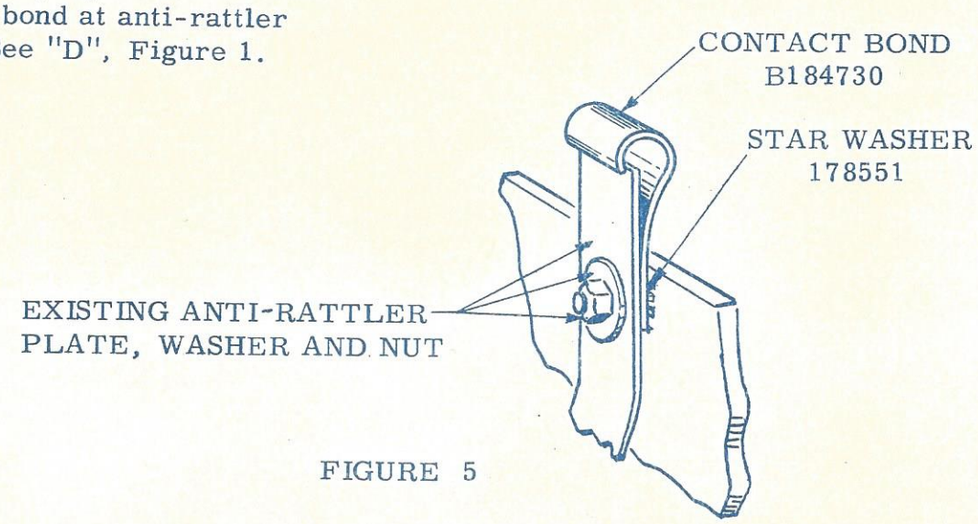


FIGURE 5

Supersedes Ordnance Tracing A5700025, 5April 1944, Rev. B, 5-25-44

CONTROL DRAWING-OCO-D H. T. V. Engr. Sub-Office Ardmore, Pa.	Approved 9-22-44	Fred C. Adams 1st Lt., Ord. Dept. Officer-in-Charge	Drwg. Size A5700025 Sheet 5 of 9
CLARK CABLE CORP. **CLEVELAND, OHIO**	Drwg. No. 2873-5 Date 1-30-52		Traced By I.R.I. Ck'd By S.S.